
## MARION COUNTY SURVEYOR'S OFFICE

DEBRA S. JENKINS MARION COUNTY SURVEYOR

SEC. 16 TWN. 14<sub>N</sub> RNG. 2<sub>E</sub>

SECTION CORNER RECORD

BRYAN F. CATLIN, PLS TECHNICAL SUPERVISOR

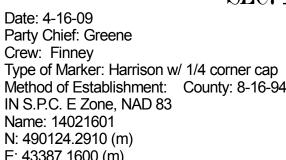


Method of Establishment: County: 8-16-94 E: 43387.1600 (m) 7.

Camby Rd 7000 S Raceway Rd 9300 W

**Hendricks County** 

104.37

Camby Rd 7000 S

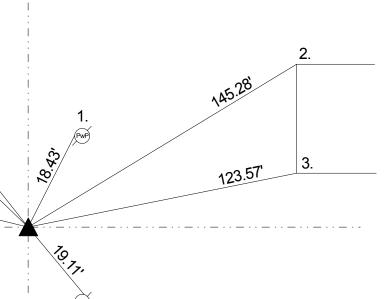

Original post set 1820 by Laughlin with witnesses: 10" beech S 33 E 31 links, 18" hickory N 49 W 13 links per Marion County Atlas pg. 1. Fatout 1-16-1881 called rock set with witnesses: 30" oak N 26 E 37 links, 30" oak N 20 W 41 links. 7-24-63 G.W.S. called 1" steel pin. 3-15-76 Miller called same. 7-8-85 Greene called same. 9-4-85 Greene excavated and found RR spike at surface, 1" steel pin found 5" down, stone found 12" down. Harrison set. Re-tied 8-16-94 by Kiste. Re-tied 5-20-99 by Kiste.

REF.	DISTANCE	DESCRIPTION
1.	50.55'	Road nail W PwP #7-741W 24"up
2.	145.28'	NW corner one-story frame
3.	123.57'	SW corner one-story frame
4.	19.11'	Mag nail w/washer NE PwP #6-741W 12" up
5.	104.37'	PK nail N PwP no # 60" up
6.	193.09'	SE corner house #1098 block : Hendricks County
7.	200.37'	SE corner house #1098 block : Hendricks County